


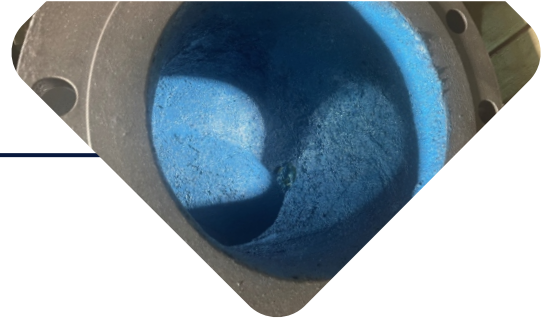

DURA-COAT ARMOR FAST 350

DESCRIPTION AND RECOMMENDED USES

Dura-Coat® Armor Fast 350 is a rapid-curing, ceramic-filled epoxy coating that is 100% solids and solvent-free, formulated for the protection of metal substrates exposed to highly aggressive industrial environments, especially where severe abrasive wear and high impact conditions are present. It provides excellent chemical resistance to a wide range of acidic and caustic solutions. The material can be easily applied using a plastic broom or putty knife at thicknesses up to 1000 mils per coat, without sagging.

- Can be applied up to 1000 mils without sagging
- Suitable for any substrate, including steel, bronze, aluminum, and concrete
- Suitable for corrosion and abrasion protection
- Designed for the rebuilding of worn parts

PACKAGES

	SIZE	REORDER #
OPTIONS	1 kg	320-01
	6 lbs	320-06LB
	25 lbs	320-25LB
	20 kg	320-20


APPLICATION AREAS

- Bins
- Chutes and hoppers
- Coal crushers
- Fans and housings
- Impellers
- Pipe elbows
- Propellers
- Pump cases
- Screw conveyors
- Wear plates
- Many others

TECHNICAL DATA

Maximum Temperature (dependent on service)	Wet Service	75°C	167°F
	Dry Service	97°C	206°F
Chemical Resistance	Water	Excellent	
	Alkalis	Excellent	
	Inorganic Acids	Good	
	Organic Acids	Good	
	Organic Solvents	Good	
Solids by Volume		100%	
Viscosity		Pasty	
Mixed Density		2.3	
Shore D Durometer Hardness	(ASTM D 2240)	85	
Pot Life		25 min / kg at 72°F	
Vertical SAG Resistance at 21°C (70°F) and 12.7mm (500mils)		No sag	
Coverage for 25 lbs Kit	8.8sf@240mils	0,82m²@6mm	
Mix Ratio	2:1 by weight		Base: Activator
Color	Standard blue. Gray and red optional. For other colors, consult factory.		
Shelf Life (unopened containers)	3 years at 55-95°F (13-35°C)		



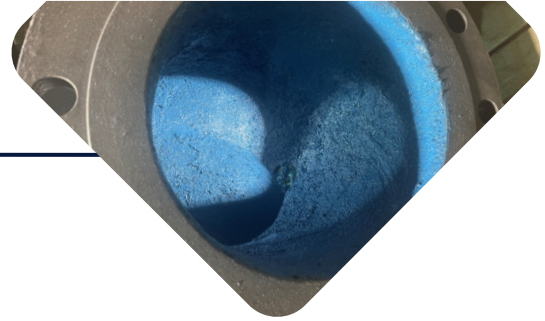

DURA-COAT ARMOR FAST 350

SURFACE PREPARATION

Proper surface preparation is critical to the long-term performance of this product. The exact requirements for surface preparation vary with the severity of the application, expected service life, and the initial substrate conditions. Minimum preparation is mechanical preparation St2/St3. Optimum preparation will provide a surface thoroughly cleaned of all contaminants and roughened to an angular profile between 75-125 µm (3-5 mil). This is normally achieved by initial cleaning and degreasing and then abrasive blasting to a cleanliness of Near White Metal (Sa.21/2), followed by removal of residual abrasive blast residues from the surface to be coated.

MIXING

Thoroughly mix Activator into Base with mixing stick or drill with low-speed mixing blade scraping sides and bottom of container or mixing board. Mix by weight 2-parts Base to 1-part Activator. Mix thoroughly to produce an even colored and streak-free material. THINNING: Never thin.

CURED TIME

	16°C (60°F)	25°C (77°F)	32°C (90°F)
TACK FREE	45 mins.	30 mins.	20 mins.
LIGHT LOAD	1 hour	45 mins.	30 mins.
OVERCOAT END	1 hour	45 mins.	30 mins.
FULL LOAD	1.5 hours	1 hour	45 mins.
FULL CHEMICAL	4 hours	3 hours	2 hours

APPLICATION

Use heavy plastic squeegee or putty knife to apply a 3 mm minimum thickness. Work material into profile of substrate to achieve maximum adhesive and to remove any entrapped air. Contour to correct form with putty knife or plastic applicator. If mold or form is used be sure to coat its surface with a release agent to prevent adhesion of the material.

APPLICATION TEMPERATURE

Keep between 55 to 95°F (17 to 35°C). Substrate: keep between 45 to 105°F (7 to 40°C). The difference in temperature of the substrate and the material should never exceed 10°F, 5°C. Substrate shall be a minimum of 5°F (3°C) above dew point. Do not apply if relative humidity exceeds 90%. If necessary, heat the metal prior to surface preparation using electric heater or heat lamp. Never use gas, oil, or kerosene heaters as they will leave a greasy residue on metal surface. For best results keep all material in warm area overnight (75°F+) for ease of mixing.

CLEAN UP

Tools must be immediately cleaned after usage by using industrial alkaline detergent.

SAFETY

Before using any products, review the appropriate Safety Data Sheet (SDS) or Safety Sheet for your area. Follow standard confined space entry and work procedures, if appropriate.

Manufacturer, Dura-Coat Industrial Inc., makes no warranty either expressed or implied including warranties of merchantability or fitness for a particular purpose for this product. Under no circumstances will the manufacturer be liable for incidental, consequential, or other damages, breach of warranty, strict liability, or any other theory arising out of use of this product. The information and/or recommendations contained herein are based on standard Product and are proprietary and furnished solely for the use of our customers. This information is provided in good faith and believed to be true and accurate as of the date/version of this document. As the manufacturer has no control over the use conditions or application process of the parties using this product, the manufacturer cannot accept responsibility for loss, injury or other damages resulting from the use of the Product or this or any other information provided by the manufacturer. Therefore, no guarantees of any kind, expressed or implied, are made by the manufacturer, Dura-Coat Industrial Inc., regarding this, or any, product manufactured by them or any contracted or licensed manufacturer. DURA-COAT® epoxy products do not provide structural integrity or improvement. They are only used to provide protection from corrosion, wear, abrasion and chemical attack on a given substrate and only to the extent provided for in the Data Sheets, Technical Data Sheets, Safety Data Sheets, and any other information as supplied in writing directly from manufacturers technical support.

