

DURA-COAT HIGH TEMPERATURE STRUCTURAL PUTTY 2000

DESCRIPTION AND RECOMMENDED USES

Dura-Coat High Temperature Structural Putty 2000, with 100% solids, is a high-functionality, solvent-free Novolac epoxy coating that cures at ambient temperature. It is specifically designed as a rebuilding material for metals in immersion service under highly aggressive chemical and high-temperature environments. Dura-Coat High Temperature Structural Putty 2000 is easy to use, non-sagging, and provides excellent high-temperature resistance and high mechanical strength. It can withstand up to 230°C in continuous operation and up to 280°C intermittently.

- Can be applied in thicknesses of up to 500 mils without sagging
- Ideally suited as a coating material for restoration against corrosion
- Suitable for protection against corrosion and abrasion
- Suitable for immersion and non-immersion service

PACKAGES

	SIZE	REORDER #
OPTIONS	1kg	2000-01
	2kg	2000-02
	10kg	2000-10
	18kg	2000-18

FDA COMPLIANCE


This product complies with FDA regulations for direct food contact, specifically FDA 21 CFR 175.300 and FDA 21 CFR 175.105.

APPLICATION AREAS

- Metal structures
- Chemical storage tanks
- Fans and housings
- Heat exchangers
- Ducts
- Power plant
- Tank linings
- Mixing areas
- Scrubbers
- Leak in hot oil pipeline

TECHNICAL DATA

Maximum Temperature (dependent on service)	Wet Service	230°C	446°F
	Dry Service	280°C	536°F
Chemical Resistance	Water	Excellent	
	Alkalis	Excellent	
	Inorganic Acids	Excellent	
	Organic Acids	Excellent	
	Organic Solvents	Excellent	
Solids by Volume		100%	
Viscosity		Paste	
Mixed Density		1.8	
Shore D Durometer Hardness	(ASTM D 2240)	85	
Pot Life		60 min / kg at 72°F	
Vertical SAG Resistance at 21°C (70°F) and 12 mm (1/2")		No sag	
Coverage for 10kg Kit	60sf@40mils	5.6m ² @1mm	
Mix Ratio	2:1 by weight		Base: Activator
Color	Gray as standard. Blue and red optional. Other colors contact the manufacture		
Shelf Life (unopened containers)	3 years at 55-95°F (13-35°C)		

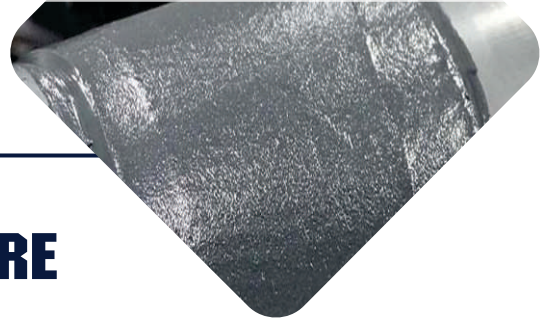

DURA-COAT HIGH TEMPERATURE STRUCTURAL PUTTY 2000

SURFACE PREPARATION

Proper surface preparation is critical to the long-term performance of this product. The exact requirements for surface preparation vary depending on the severity of the application, the expected service life, and the initial condition of the substrate. The minimum preparation is mechanical preparation St2/St3. The optimum preparation will provide a surface completely free of all contaminants and with a rough angular profile between 75–125 µm (3–5 mils). This is normally achieved through initial cleaning and degreasing, followed by abrasive blasting to a near-white metal finish (Sa 2 ½), and finally removing any remaining abrasive residues from the surface to be coated.

MIXING

Thoroughly mix the Activator into the Base using a mixing stick or a low-speed drill with a mixing paddle, scraping the sides and bottom of the container or mixing board. Mix at a ratio of 2 parts Base to 1 part Activator by weight. Mix well until a uniform, streak-free material is obtained. **THINNING:** Never thin.

CURED TIME

For enhanced performance, post-cure for 2 hours at 80°C (176°F) and 3 hours at 150°C (302°F).

	16°C (60°F)	25°C (77°F)	32°C (90°F)
TACK FREE	1,5 hours	1 hour	45 min.
LIGHT LOAD	3 hours	2 hours	1,5 hours
OVERCOAT END	3 hours	2 hours	1,5 hours
FULL LOAD	12 hours	6 hours	4 hours
FULL CHEMICAL	36 hours	24 hours	18 hours

APPLICATION

Use a sturdy plastic spatula or a putty knife. Work the material into the substrate profile to achieve maximum adhesion and eliminate any entrapped air. Shape to the correct form with the putty knife or plastic applicator. If using a mold or form, coat its surface with a release agent to prevent the material from sticking. Machining can be carried out using carbide-tipped tools. Sanding is possible if performed within 14 hours after application at 25°C (77°F) (add 1½ hours for every 10°F below 77°F and subtract 1 hour for every 10°F above 77°F). Large holes and cracks may be reinforced with fiberglass cloth or metal.

APPLICATION TEMPERATURE

Keep the temperature between 55 and 95°F (17 to 35°C). The substrate must be maintained between 45 and 105°F (7 to 40°C). The temperature difference between the substrate and the material should never exceed 10°F (5°C). The substrate shall be at least 5°F (3°C) above the dew point. Do not apply if the relative humidity exceeds 90%. If necessary, heat the metal prior to surface preparation using an electric heater or heat lamp. Never use gas, oil, or kerosene heaters, as they will leave an oily residue on the metal surface. For best results, keep all material in a heated area overnight (above 75°F) to facilitate mixing.

CLEAN UP

Tools must be immediately cleaned after usage by using industrial alkaline detergent.

SAFETY

Before using any products, review the appropriate Safety Data Sheet (SDS) or Safety Sheet for your area. Follow standard confined space entry and work procedures, if appropriate.

Manufacturer, Dura-Coat Industrial Inc., makes no warranty either expressed or implied including warranties of merchantability or fitness for a particular purpose for this product. Under no circumstances will the manufacturer be liable for incidental, consequential, or other damages, breach of warranty, strict liability, or any other theory arising out of use of this product. The information and/or recommendations contained herein are based on standard Product and are proprietary and furnished solely for the use of our customers. This information is provided in good faith and believed to be true and accurate as of the date/version of this document. As the manufacturer has no control over the use conditions or application process of the parties using this product, the manufacturer cannot accept responsibility for loss, injury or other damages resulting from the use of the Product or this or any other information provided by the manufacturer. Therefore, no guarantees of any kind, expressed or implied, are made by the manufacturer, Dura-Coat Industrial Inc., regarding this, or any, product manufactured by them or any contracted or licensed manufacturer. DURA-COAT® epoxy products do not provide structural integrity or improvement. They are only used to provide protection from corrosion, wear, abrasion and chemical attack on a given substrate and only to the extent provided for in the Data Sheets, Technical Data Sheets, Safety Data Sheets, and any other information as supplied in writing directly from manufacturers technical support.